


Model: VIOLA ROSSE SILK 120X120(6)(A)

Codes: 100288019

Absorption: Bla - Porcelánico ($E \leq 0.1\%$)

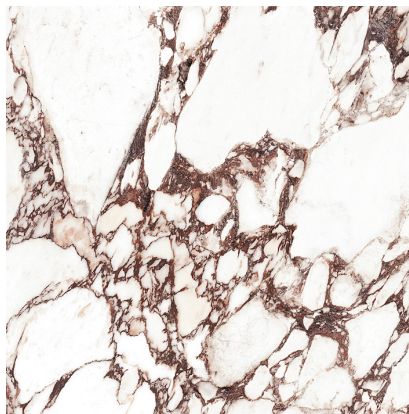

DIMENSIONAL FEATURES

UNE-EN ISO 10545-2

Length	1200 MM	
Thickness	6 MM	
Width	1200 MM	
Length and width deviation	Below 0.15%	+/-0.3%*
Side straightness deviation	Below 0.15%	+/-0.3%*
Squareness deviation	Below 0.15%	+/-0.3%*
Surface flatness deviation	Below 0.15%	+/-0.4%*

*ISO-13006:2015 UNE-EN 14411:2017

MECHANICAL FEATURES

UNE-EN ISO 10545-4-6-7-11

Breaking strenght	>1100 N	
Modulus of rupture	>45 N/MM2	
Abrasion resistance	<140	

*ISO-13006:2015 UNE-EN 14411:2017

HYGIENIC FEATURES

UNE-EN ISO 10545-13-14

Chemical resistance	CLASE A	
Stain resistance	5	
Resistance to cold food products	APTO	
Resistance to hot food products	APTO	
Fastness to rubbing	APTO	
Dimensional stability at elevated temperature	CUMPLE	
Climate shock test. resistance index	RESISTE	
Resistance to thermal shock	RESISTE	
Flammability	A1	

*ISO-13006:2015 UNE-EN 14411:2017

System Certification



Do not use cleaning agents containing hydrofluoric acid.

It is recommended to fix tiles with a minimum joint of 1,5 mm. Do not fix without joint.

For big sizes, it is recommended to fix with mortars containing polymeric additives and to use the double glueing technique.

Mosaic tiles must be grouted.

This document is only commercial and cannot be used as expert opinion, documentary evidence or in any legal or administrative procedure unless authorized by PORCELANOSA S.A.

ANTI-SLIP VALUE

CEN/TS 41901/02, DIN-51130 y ASTM A137.1

Slip resistance (pendulum-wet)	CL0	
Resistance to bacteria	APTO	
Resistance to cleaning products	APTO	
Resistance to bathroom cleaning products	APTO	
Resistance to cigarette burns	APTO	
4s	DRY>36-LOW_WET<25-HIGH	
Slip resistance (pendulum-dry)	>45	

*ISO-13006:2015 UNE-EN 14411:2017

SCOPE OF USE

Technical code-1	Use on light traffic floors	
Technical code-2	Dry interior floors	

PACKING

Sales units per box	2.88 M2/BOX	
Sales units per pallet	74.88 M2/PAL	
Sales units per unit	1.44 M2/PIECE	

System Certification



Do not use cleaning agents containing hydrofluoric acid.

It is recommended to fix tiles with a minimum joint of 1,5 mm. Do not fix without joint.

For big sizes, it is recommended to fix with mortars containing polymeric additives and to use the double glueing technique.

Mosaic tiles must be grouted.

This document is only commercial and cannot be used as expert opinion, documentary evidence or in any legal or administrative procedure unless authorized by PORCELANOSA S.A.